



EPA Region 5 Records Ctr.



298136

STATE OF ILLINOIS
ENVIRONMENTAL PROTECTION AGENCY

NARRATIVE INSPECTION REPORT DOCUMENT

Date of Inspection: April 17, 1987 Inspector: John Maher
Site Code: 0 3 1 1 0 2 0 0 0 1 County: Cook
Site Name: Krohn ~~Landfill~~ Time: 0830 h - 1230 h

GENERAL REMARKS

This inspection began at about 8:30 a.m. when Rob Sulski (IEPA/DWPC)
and I took samples of leachate on the east side of the site. After the
samples and photographs were taken, I continued the inspection alone.

I introduced myself to the site operator, then I walked around the
site. I observed the following violations:

807.302 - Failure to comply with the terms and conditions of the
operating permit. Specifically, leachate emerging from
the site has not been controlled by prompt application
of additional soil, spreading and compacting and
reseeding as necessary to prevent erosion.

807.303(a) - Refuse was being deposited at the top of the fill
instead of the toe of the fill.

807.303(c) - The working face had a slope greater than two
horizontal to one vertical.

21(p)(5) - Uncovered refuse remaining from the previous operating
day.

807.305(a) - Inadequate depth of daily cover.

807.305(b) - Inadequate depth of intermediate cover.

21(p)(7) - Acceptance of waste (i.e., foundry sand) without necessary permits.

807.313 - Causing and allowing the operation of the landfill so as to cause water pollution in Illinois.

21(p)(2) - Allowing leachate to enter the Waters of the State.

21(p)(3) - Leachate flows exiting the landfill confines.

807.314(e) - Inadequate measures to monitor and control leachate.

21(p)(1) - Refuse in standing water.

21(p)(10) - Acceptance of special waste (i.e., foundry sand) without a required manifest.

809.302(a) - Acceptance of special waste (i.e., foundry sand) for disposal from a waste hauler that did not present a signed manifest.

This site was accepting non-putrescible refuse and "clean" dirt at the time of the inspection. Conditions were moderately dry, but dust was not presenting a problem.

NOTE:	Violation	Photographs
	807.302	3, 4, 5, 6, 7, 20, 21, 22, 23
	807.303(a)	24, 34, 35
	807.303(c)	26, 27
	21(p)(5)	24, 25, 36
	807.305(a)	24, 25, 36
	807.305(b)	24, 25, 36
	21(p)(7)	31, 32, 33
	807.313	4, 5, 6, 7, 20, 21, 22, 23



STATE OF ILLINOIS
ENVIRONMENTAL PROTECTION AGENCY

SITE SKETCH

Location of
Photographs

Date of Inspection: 4-17-87


Inspector: JOHN MAHER

Site Code: 0311020001

County: COOK

Site Name: Krohn

Time: 8:30 AM - 12:30 AM

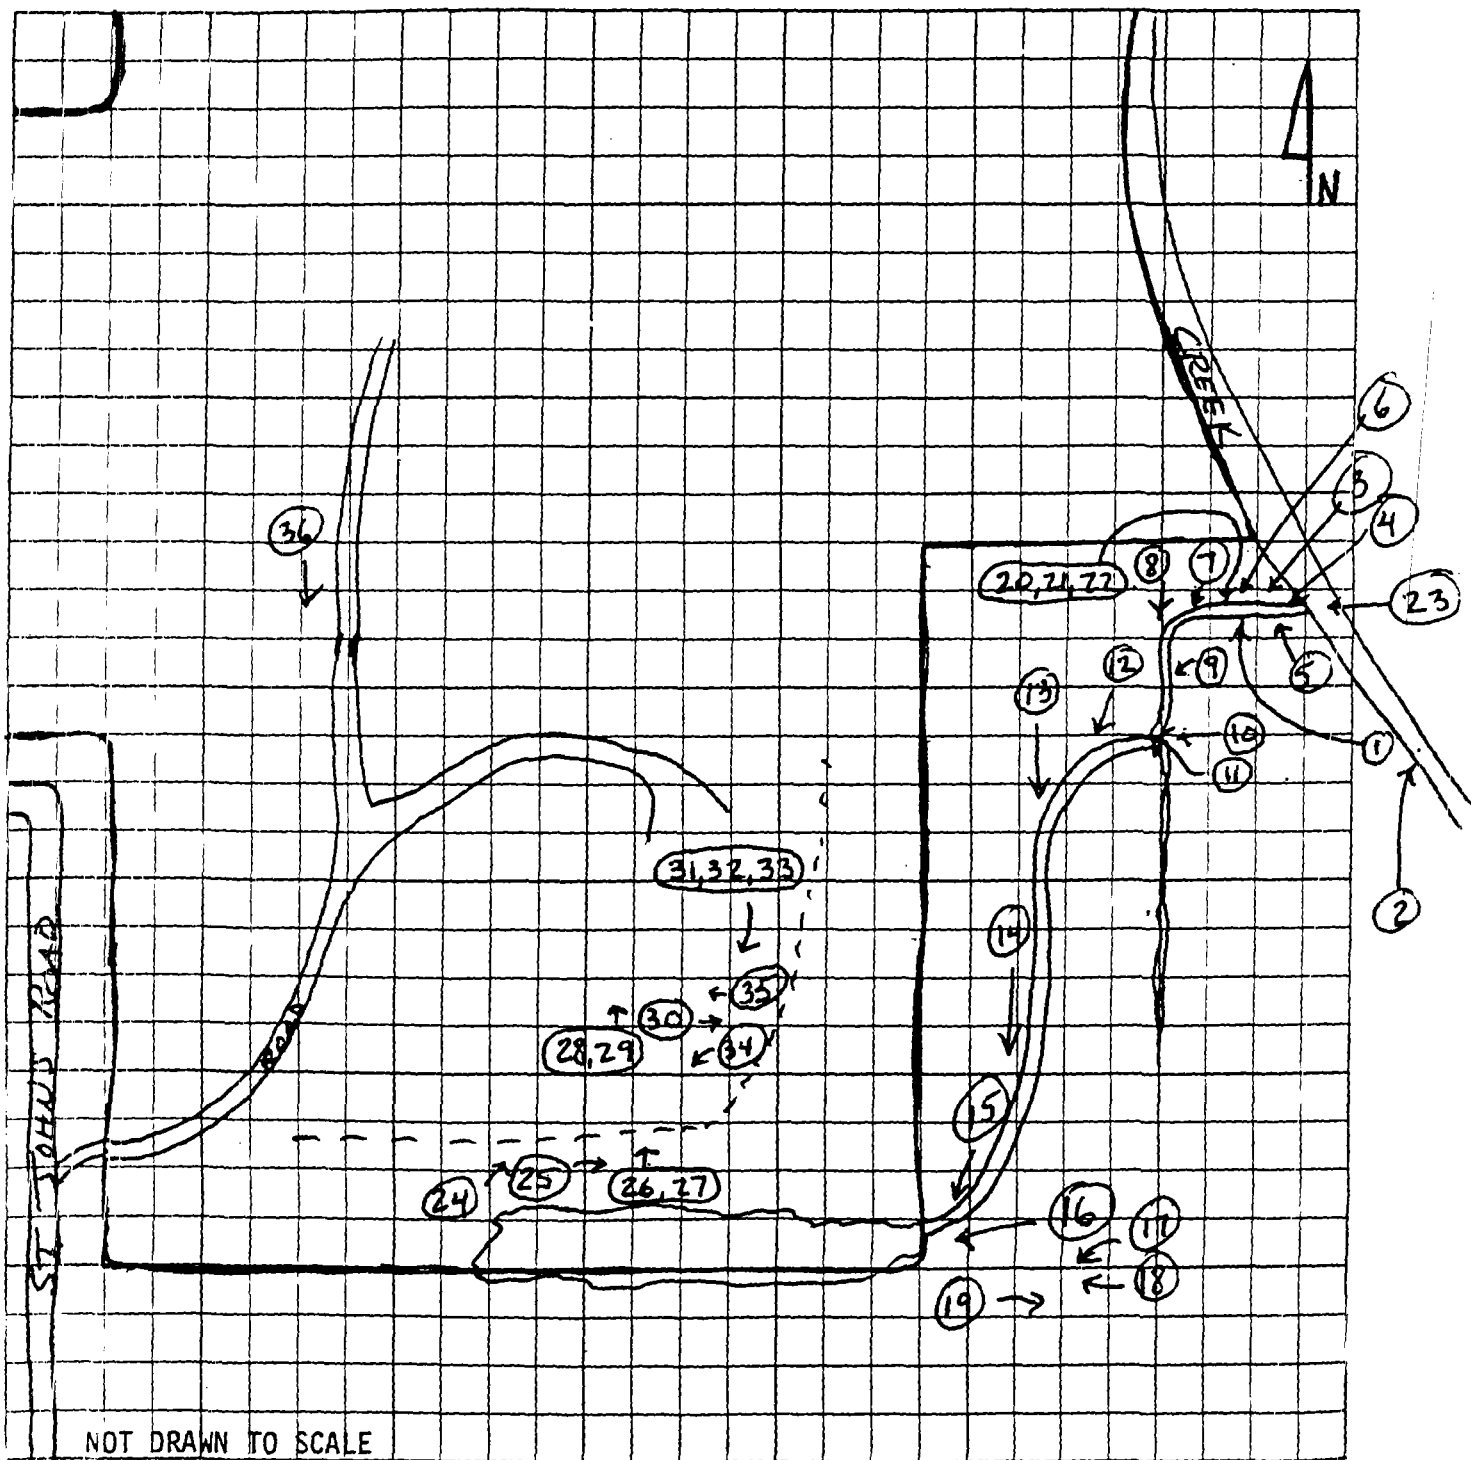

STATE OF ILLINOIS
ENVIRONMENTAL PROTECTION AGENCY

SITE SKETCH

Date of Inspection: 4-17-87 Inspector: John Maher
Site Code: 0311020001 County: Cook
Site Name: Krahn ~~XXXXXXXXXX~~ Time: 8:30 AM - 12:30 PM

